

Manhole Inspection Summary

Manhole # S55C2_006MH

Printed On: 7/7/2009

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **2) Good**

Record Plat: **55C2** Node: **006** Status: **Found**

Insp Date: **6/10/09 1:42 PM**

Incomplete Comments

Crew: **B**
Inspector: **CrewB**
Firm: **KEC**

Location Address: **3701 Leo St.**

Cross Street: **Northbridge Ave.**

Manhole Type: **Junction** Location: **Alley**

Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry**

Subject To Ponding: **None**

Comments **Inside drop connection combines 3- and 9-o'clock pipes in a channel that drops down to trunk line below**

Cover Shape: **Circular** Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☒ Exists Material: **Brick** ☐ Parged Height: **3** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Corbel Material: **Brick** ☐ Parged Type: **Flat top**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Barrel Material: **Brick** ☐ Parged

Shape: **Rectangular** Diameter: **72** (in.) Length: **72** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Bench ☐ Exists Material: ☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **4** Missing: **0** ☒ **Corroded**

Surcharge ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S55C2_006MH

Printed On: 7/7/2009

Page 2 of 4

Location View



3701 Leo St.

Top View



All stairs visible in this photo

3 oclock and 9 oclock combined drop.



Manhole Inspection Summary


Manhole # S55C2_006MH

Printed On: 7/7/2009

Page 3 of 4

54 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow

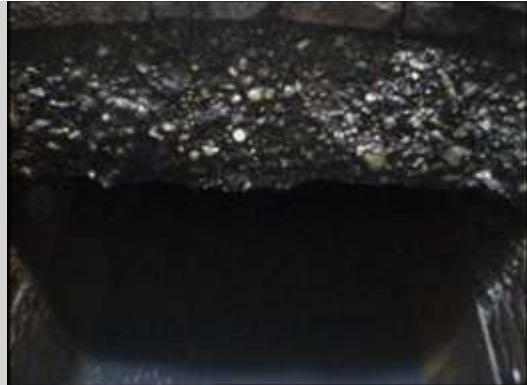

Pipe Height: **50.4** (in.) Rod and Bar (Angled)
Pipe Material: **Concrete** ☐ Pipe Lined
Invert Depth: **20.68** (ft.) Flow Characteristics: **Fast**
Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease
Silt Depth: **4** (in.) Deposits Extent: **Heavy**
Infiltration: **None** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

10 in. Circular Gravity Sewer
Pipe In @ 3 O'Clock

3 O'Clock Inflow



Pipe Height: **10.8** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **11.88** (ft.) Flow Characteristics: **Fast**
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ **Debris** ☐ Grease
Silt Depth: (in.) Deposits Extent:
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **Inside** **Direct**
Angled: **Yes** Reading: (ft.)
Inv Depth: **20.68** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S55C2_006MH

Printed On: 7/7/2009

Page 4 of 4

54 in. Circular Gravity Sewer

6 O'Clock Inflow

Pipe In @ 6 O'Clock



including 3 oclock and 9 oclock combined drop

Pipe Height: **52.8** (in.) Rod and Bar (Angled)

Pipe Material: **Concrete** ☐ Pipe Lined

Invert Depth: **20.68** (ft.) Flow Characteristics: **Fast**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **4** (in.) Deposits Extent: **Heavy**

Infiltration: **None** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

9 O'Clock Inflow

Pipe In @ 9 O'Clock



Pipe Height: **9.6** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **11.76** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ **None** ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **Inside**

Direct

Angled: **Yes**

Reading: **19.68** (ft.)

Inv Depth: **20.68** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection